

Airworthiness Directive

| 81-74/2 Schleicher

| Date of issue:

| 24, April 1981

| Affected sailplanes:

| German Type Certificate No.308
| Schleicher ASW 19, all models,
| all serial numbers.

| German Type Certificate No.314
| Schleicher ASW 20, all models,
| all serial numbers.

| Subject:


| Aileron hinge

| Reason:

| It may be possible that the aileron hinge shaft
| is not correctly secured.

| Action and compliance:

| Unless already accomplished, check the aileron hinges
| prior to next flight after publication of this AD to
| see, whether the pop rivet securing the aileron hinge
| shaft is in its place (see figure).
| The rivet head can be felt under the adhesive tape.
| If necessary, remove this tape to facilitate checking.

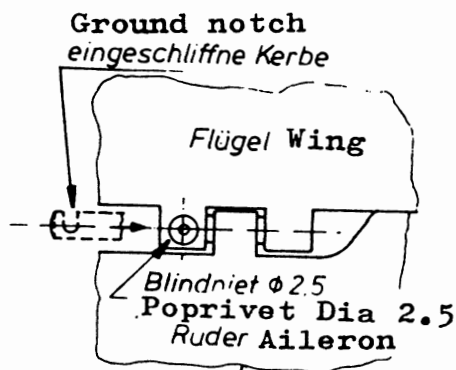

| Accomplishment and log book entry:

| Action to be accomplished by an approved service
| station and to be entered in the sailplane's log.

| Note:

| This Airworthiness Directive replaces AD-No. 81-74
| of 13, April 1981.