Alexander Schleicher - Segelflugzeugbau - Poppenhausen/Wasserk.

Modification No. 10 Glider Rhönlerche L - 164 ( US 7G6 )

Page 1


Check of stick attachment in the rear cockpit.

Probable by deformation on the tube nozzles there has been found a loose stick although the wing nut was fastened.

Urgency:

Description of modification:

- 1) Check if the both tube nozzles are not bended by the screw so that it is possible to pull out the stick even when the wing nut is fastened.
- 2) Check the gap for the wide of 2 mm (0,08 inch). If neccessary make it wider by a file. (See scetch). With fastened wing nut, the stick must be reliablely fixed.

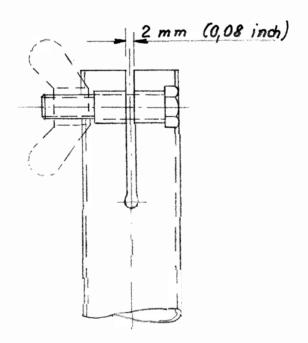

Approval of translation has been done by best knowledge and judgement. — In any case the original text in German language is authoritative.

Remarks			PfL - Check
ausgef.	16.4.63.	Kaiser	Pfl Renih
			53 A
			2 5. April 1963