


Reason: Installation of larger buffer plates for the rubber buffer of landing gear.

On one occasion the 70 mm dia. buffer plate slipped into the rubber buffer end with the big hole.

Description: Remove the rubber block and replace the buffer plate at the end with the large hole by a plate of 90 mm dia. This new plate is to be installed on top of the rubber block.

To be made until 1.1.1969.

LTA Nr. 68/110

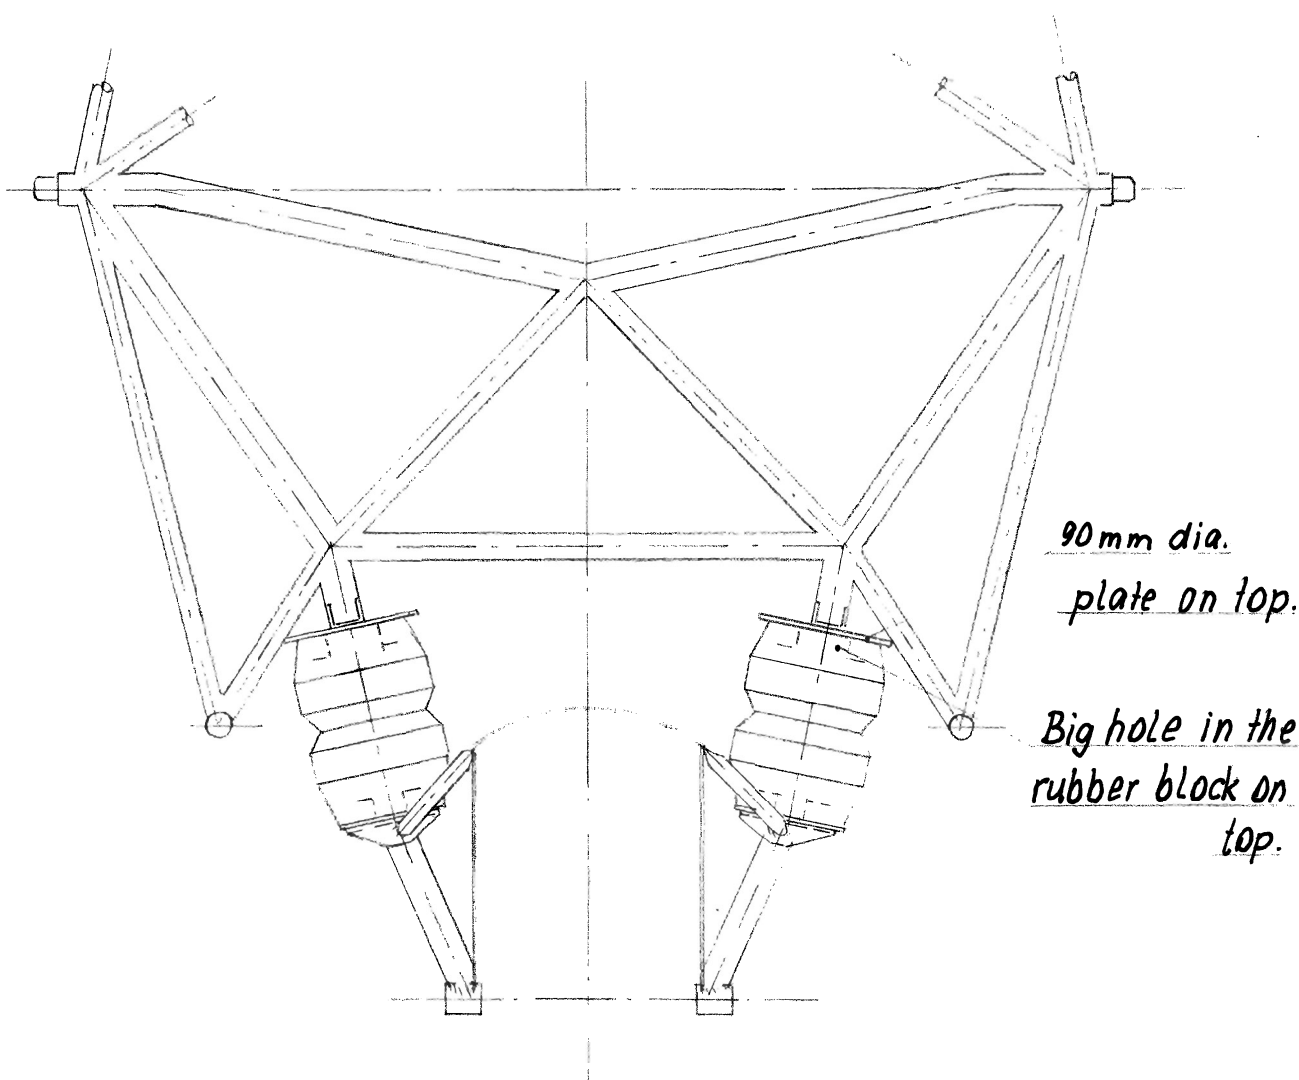

Drawings to be corrected	Remarks	LBA - Approved
L-267.10-S 7 and S 11 to be corrected.	4.9.68  Modification is made by the manufacturer at S.Nb. 13071, 13096 and since 13105 without 13108 and 13109.	German original signed: Friess 16.9.1968