Sheet 1 of 3

AS - K 13 Service Bulletin No. 13 SPURI FILUGZEUGBAG JUBI GMBH ROBERT-KRONFELD-STR. 2 4811 OERLINGHAUSEN TEL. (0.5202) 72446

Subject:

Inspection of the main-fittings

Affected Sailplane:

German Type Certificate No. 267

AS - K 13

Serial No. 13618 - 13686 incl. and

Serial No. 13689, all with addition A.B.

Compliance:

Action 1. and 1.1. before next flight Action 2. before next flight

Action 3. if necessary before next flight

Reason:

Possible non-observance of the tolerance on the backside of the main fitting-holes can lead to an light movement from the main

fitting to the end spar.

Action 1.

Affected Serial No. 13618 A.B. - 13665 A.B. and No. 13667 A.B. - 13670 A.B.

Check the main-fitting for possible traces, which show to a movement of the fitting and end spar. It looks like cracks in the varnish between metall and wood. This controll have to

be done in rebuilded condition.

Action 1.1.

Check the bolts in front of the root-ribs. Therefor take a pin, 550 mm long with 9,5 mm diameter into the bolts and work with hand-power. The controll have to be done out of the backside of the wing end spar. If there is no objektion, flight operation is already possible.

Sheet 2 of 3

AS - K 13 Service Bulletin No. 13 SPORTFLUGZEUGBAU
JUBI GMBH
ROBERT-KRONFELD-STR. 2
4811 OERLINGHAUSEN
TEL. (05202) 72446

Action 2.

Serial No. 13671 A.B. - 13686 A.B. and also 13666 A.B. and 13689 A.B.

Out of action 1. is following check to do:
Untie the nuts M 18 x 1,5 mm of all bolts.
Replace the bolts 50 mm out of the holes and
measure the holes in the spar - wood and the
fitting - metall. The holes diameter 18 mmø
is authoritative. The bolts behind the root ribs are to check from the underside of the wing.
For that purpose see the drawing sheet 3. If
there is no deviation, replace the bolts in the
old position and also the nuts.
Unconditional is the right place of the wedgeshaped discs. Powerment of the bolts is 75 lbs/ft.

Action 3.

Shows the check a difference of holes-diameter there is for next steps an agreement with the manufacturer to aspire.

Remarks:

Action 1. - 1.1. - 2. is only execute from the manufacturer or an authorized approved aviation workshop.

Action 3. is only execute from the manufacturer or an especially instructed aviation - workshop. The correct execution has to be certified in the log-book by an authorized Inspector, Class 3.

Oerlinghausen, the 19th Dec. 1990

SPORTFLUGZEUGBAU JUBI, GMBH

The German Original of this Service Bulletin has been approved by the LBA on January 11, 1991 and is signed by Mr. Skov. The translation into English has been done by best knowledge and judgement. In any case of doubt the German Original is authoritative.

SPORTFLUGZEUGBAU JUBI GMBH ROBERT-KRONFELD-STR. 2 AS - K 13 Sheet 3 of 3 4811 OERLINGHAUSEN TEL. (05202) 72446 Service Bulletin No. 13 : Drawing Left wing underside Triple - Ledge Dreiecksleiste Papper 5-20 Poplar 210 mm Sph2. Inspection- holes PLywood on under side Rippe 2 Rib 2 Triple-ledje Dreiecksleisten uter appen 1955en Triple-ledye Dreiecksleiste Papper SL20 Poplar 120 1,5 mm Pappel Spnz. Plywood St: