

Airworthiness Directive

70-86 Schleicher; Date: November 26, 1970

Applies to:

Glider Model K6E; German Type Certificate No. 205

All Serial Numbers up to S/N 4350 incl. -

Glider Model K 10; German Type Certificate No. 239

All Serial Numbers -

Powered Glider Model ASK 14; German type Certificate No. 684 all Serial Numbers up to S/N 14048 incl. except S/N 14043 and 12002/M -

Reason

When assembling the elevator halves there is a possible chance of plugging the safety pin on the outside of the spar tube end. In this case the elevator remains unlocked.

Action

To prevent an unsafe condition, lengthen spar tube by riveting a tube extension onto spar end in accordance with Alexander Schleicher Technical Notes K6E-No. 18 K 10-No. 2 and ASK 14-No.3. to avoid passing of the safety pin if not correctly seated.

Compliance

Before April 1, 1971

Accomplishment to be entered in the aircraft log by a licensed inspector.

Note: For technical information and parts please contact Messrs. Alexander Schleicher, Segelflugzeugbau, 6416 Poppenhausen, W. Germany