SHEET: 1 of 1

ASK 21 **Technical Note** No. 26

Alexander Schleicher

GmbH & Co. Segelflugzeugbau 6416 Poppenhausen

new zip code: D-36163

Subject:

Inspecting the elevator pushrod.

Serial number applicability:

All ASK 21, data sheet.no. L-339, serial no.s 21001 thru

21205 including; except those which have already been modi-

fied according to TN no.11.

Compliance:

Must be accomplished with the next annual C. of A. inspec-

tion, but before or on March 31, 1994, at the latest.

Reason:

Some cases with sailplane types of other manufacturers have been reported where the elevator pushrods showed

heavy corrosion under especially unfavorable conditions.

As a provisional measure in view of flight safety this incident moves us to require an inspection of the elevator pushon the ASK 21 sailplanes, i.e. only on those which have not yet been modified to the automatic elevator

connection as per TN no.11.

Action:

Remove the rudder and the elevator pushrod 4 in the fin (see Maintenance Manual, page 11a, item 29 - in the US manual, page 9). In accordance with the drawing 210.48.0019 (Rev. Note "A" dated June 30, 1993) a 6 mm dia. hole must be U-bracket of the pushrod end. Inspect the drilled in the pushrod inside for corrosion (visual inspection through drilled hole with a suitable instrument, e.g. an endoscope, or remove the pushrod end by drilling out the blind rivets).

If no corrosion is found, preserve the pushrod inside with a suitable agent (e.g. internal corrosion preventive ML made

by VOSSCHEMIE GmbH, D-Uetersen).

If corrosion of more than 10 % material loss is found, the

elevator pushrod must be replaced by a new one.

Material & drawings:

See paras "Action" and "Notes".

Notes:

This action, inspection and possible exchange of the elevator pushrod can be accomplished by a competent person. The accomplishment of this mod must be certified by a licensed aviation inspector in the glider's inspection documents

in the log-book.

A new elevator pushrod P/N 210.48.0019 (TN no.26) or a pushrod end P/N 210.48.0021 (TN no.26) can be ordered from Messrs.SCHLEICHER (Fax +49-6658-8940) or direct from the

SCHLEICHER agent in your country.

Poppenhausen, July 1, 1993

**ALEXANDER SCHLEICHER** 

GmbH & Co.

The German original of this Technical Note has been approved by the LBA under the date of August 24, 1993 (signature: SCHMALJOHANN). The translation into English has been done by best knowledge and judgement; in any case of doubt the German original is controlling.