

Airworthiness Directive

| 81-74/2 Schleicher

| Date of issue:

| 24, April 1981

Affected sailplanes:

| German Type Certificate No.308
| Schleicher ASW 19, all models,
| all serial numbers.

| German Type Certificate No.314
| Schleicher ASW 20, all models,
| all serial numbers.

Subject:


Aileron hinge

Reason:

It may be possible that the aileron hinge shaft
is not correctly secured.

Action and compliance:

Unless already accomplished, check the aileron hinges
prior to next flight after publication of this AD to
see, whether the pop rivet securing the aileron hinge
shaft is in its place (see figure).
The rivet head can be felt under the adhesive tape.
If necessary, remove this tape to facilitate checking.

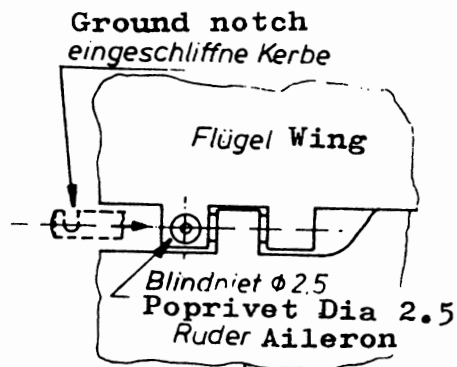

Accomplishment and log book entry:

Action to be accomplished by an approved service
station and to be entered in the sailplane's log.

Note:

This Airworthiness Directive replaces AD-No. 81-74
of 13, April 1981.