### Sheet 1 of 2

## **ASW 28**

# Maintenance Instruction B Issue 1

Alexander Schleicher

GmbH & Co. Segelflugzeugbau D - 36163 Poppenhausen

Subject:

Turbulators (Zig-Zag-tapes) for winglets, horizontal and vertical tail planes

Serial number applicability:

All ASW 28

Reason:

Modern profile sections as used for high performance sailplanes are designed in such a way, that they do not perform in an optimum kind when no turbulators are installed. Therefore all ASW 28 are equipped with turbulators in serial condition.

Action:

According to the positions given in drawings of Fig. 1 through 3 Zig-Zag-Tapes of the specified kind are attached to the inboard surface of the winglets, on upper and lower surface of the horizontal tail planes and on both sides of the vertical tail.

NOTE:

All glue areas must be dried and cleaned from dust and grease as good as possible!

To check the prepared glue areas, a transparent tape is glued to the area and removed again to check for remaining white dust and for good stick of the glue.

When applying the Zig-Zag-tapes to the surfaces the leading edges of the tapes must not be pressed down and the edges must not be rounded, as otherwise the aerodynamic effect of the turbulators may be impaired.

#### Material:

	Winglet, inner surface	Horizontal Tail, upper . lower		Fin, left and right
		surface .	surface	
Zig-Zag-Tape 60°, 12 mm	2 x	1 x	2 x	2 x
wide, t = 0,52 mm, ZA = 7 mm	0,5 m	2,5 m	1,2 m	1,0 m

The material can be ordered from Alexander Schleicher GmbH & Co.,

Phone: ++49 (0)6658-890 or -8929, FAX ++49 (0)6658-8940,

or e-mail: info@alexander-schleicher.de

Notes:

The action can be accomplished by a competent person.

In the case that performance measurements other kinds or positions of turbulators could be recommended, this Maintenance Instruction will be changed or amended.

The ASW 28 wings is equipped with an internal plenum channel. NACA - Intakes as well as blow holes, which act as a (blow) turbulators are installed at the lower surface of the wings.

Re-installation of the Zig-Zag-Tapes in the area of the NACA-Intakes and between outboard aileron and wing tip on the lower wing surface are given in **Maintenance Instruction A.** 

Poppenhausen, July 02, 2001

Alexander Schleicher GmbH & Co.

by order


(Lutz-Werner Jumtow)

Sheet 2 of 2

## **ASW 28**

Maintenance Instruction B Issue 1

**Alexander Schleicher** GmbH & Co. Segelflugzeugbau D - 36163 Poppenhausen

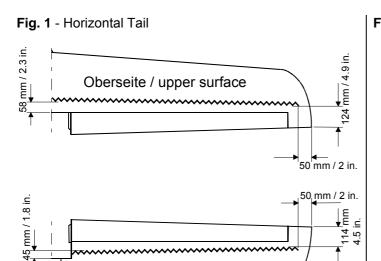

Unterseite / lower surface

Fig. 2 - Fin 25 mm / ~ 1 in. 25 mm / ~ 1 in.

Fig. 3a - Winglet, inner surface

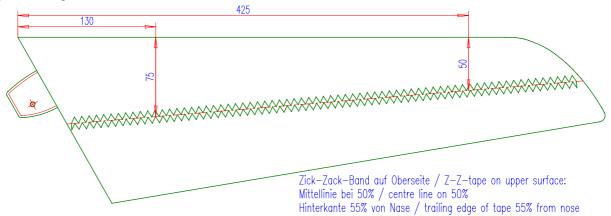


Fig. 3b - Winglet, inner surface, optional Zig-Zag-tap position

